

PELLENC POWER TOOL BATTERY POWER PACK M, L

Operating instructions

56 159267-A 03/2022

READ THE USER GUIDE CAREFULLY BEFORE USE













TABLE OF CONTENTS

1. INTRODUCTION	
2. SAFETY	6
2.1. SAFETY MEASURES ASSOCIATED WITH THE USE OF THE TOOL	6 6 7
3. DESCRIPTION AND TECHNICAL CHARACTERISTICS	. 9
3.1. TECHNICAL CHARACTERISTICS - BATTERY	9
4. COMMISSIONING	10
4.1. SWITCHING THE BATTERY ON AND OFF 4.2. BATTERY DISPLAY	10 10
5. MAINTENANCE	16
5.1. MISCELLANEOUS MAINTENANCE BATTERY	
6. INCIDENTS AND TROUBLESHOOTING	16
6.1. SUMMARY OF CHARGE INDICATOR AND BEEP MESSAGES	
7. STORAGE AND TRANSPORT	20
7.1. BATTERY STORAGE CONDITIONS	20
8. ACCESSORIES AND CONSUMABLES	20
8.1. ACCESSORIES INCLUDED	20
9. WARRANTIES	20
9.1. GENERAL WARRANTIES 9.1.1. STATUTORY WARRANTY 9.1.2. COMMERCIAL WARRANTYPELLENC 9.1.3. PAID AFTER-SALES SERVICE	20
10. COMPLIANCE STATEMENTS	23
10.1. "EU" DECLARATION OF CONFORMITY: POWER PACK M & L	23

PELLENC POWER TOOL BATTERY POWER PACK M, L 56_159267-A





1. INTRODUCTION

Dear Customer,

Thank you for purchasing your PELLENC Power Tool battery Power Pack M, L. Properly used and maintained, this equipment will give you years of satisfaction.

Warning



Your machine contains numerous recoverable or recyclable materials. Return it to your dealer or, failing this, to an approved servicing centre to be treated.



Comply with the regulations in force in your country as concerns environmental protection associated with your activity.



Warning

It is imperative that you read through the ENTIRE user's manual guide before using or servicing the tool. Always comply with the instructions and illustrations provided in the user's manual.

Throughout the user's manual guide you will find advisory notes and information entitled: NOTE, IMPORTANT, ATTENTION and WARNING.

Points marked "NOTE" indicate additional information.

Points marked "IMPORTANT" warn the user of a potential risk for the equipment.

Points marked "ATTENTION" warn the user of a potentially hazardous situations which if not avoided may result in minor injuries.

Points marked "WARNING" warn the user of a potentially hazardous situation which if not avoided may result in serious injury or death.

The warning indicates that damage resulting from failure to comply with the procedures and instructions is not covered by the warranty and the owner will be liable for any repair costs.

Safety indications are also given on the tool; they remind you of the safety precautions to be taken. Identify and read these indications before using the tool. Immediately replace any indications that may become partially illegible or deteriorated.

Refer to Section 2.4, "Safety signage" for the location diagram of the safety stickers affixed to the tool.

No part of this manual may be reproduced without the written permission of the company PELLENC. The illustrations provided in this manual are for information purposes only and are in no way contractual. The PELLENC company reserves the right to make any modification or improvement to its products as deemed necessary without informing customers already in possession of a similar model. This manual forms an integral part of the tool and must accompany the tool if it changes hands.



2. SAFETY



Warning

Never carry out maintenance work on damaged battery packs. Service of battery packs should only be performed by the manufacturer or authorized service providers.

2.1. SAFETY MEASURES ASSOCIATED WITH THE USE OF THE TOOL

Note

Please refer to the instructions of the tool concerned.



Warning

Read all safety warnings and all instructions. Retain all the safety measures and instructions for later reference.

This device is not intended for use by individuals (including children) with reduced physical, sensory or mental capabilities, nor by anyone lacking in experience or knowledge, except if they are supervised or have received prior instructions from a person responsible for their safety.

2.2. SAFETY MEASURES ASSOCIATED WITH BATTERY USE

- 1. If not using the battery unit, store it away from other metal objects such as paper clips, coins, keys, nails, screws or other such small metal items that might form a connection between the two terminals. Creating a short-circuit between the battery terminals can lead to burns or cause a fire.
- 2. Keep the battery out of the reach of children and place it on a non-combustible support.
- 3. Do not interfere with its cooling cycle.
- 4. Do not use or leave the battery near a heat source (> 60°C).
- 5. Do not leave the battery in direct, strong sunlight.
- 6. Do not expose the battery to microwaves or high pressure.
- 7. Do not immerse the battery in water.
- 8. The batteries must be charged in a dry, ventilated room at a temperature between 10°C and 25°C maximum, away from any moisture.
- 9. If the battery is not used for 10 days, the battery will automatically discharge until it reaches its storage charge rate, then goes to standby. It will heat up during this phase.
- Over time, the capacity of your battery decreases. When it reaches half of its original battery-life operating autonomy, it should be replaced.
- 11. The battery may lose 1 to 4 % of its capacity when exposed to a temperature higher than or equal to 55 °C for one week.
- 12. The charging location must be equipped with a class D fire extinguisher (for metal fires) in good working order.
- 13. The standards in effect must be complied with when shipping a complete tool or a battery.
 - Complete tool with battery: product classified UN3481 class 9.
 - Battery alone: product that is classified as class 9, UN3480.
- 14. Use of a battery other than that provided by Pellenc SA is dangerous (risk of serious injury). If a different battery is used, Pellenc SA cannot be held responsible for any consequences.
- 15. The battery must be protected from any impact and must be positioned and secured appropriately during transportation.
- 16. In the case of suspicious smoke, place the battery outside the charging area or transportation vehicle as far away as possible from any inflammable material.
- 17. Never store a battery when its capacity is below 50 %. Recharge the battery before storage if the value is below 50%.

PELLENC POWER TOOL BATTERY POWER PACK M, L 56 159267-A

- 18. In inappropriate conditions, a liquid can flow batteries; avoid contact with it. In the event of accidental contact, rinse with water. In the event of contact with eyes, seek professional medical help. The liquid leaking from the batteries can cause irritations or burns.
- 19. Pellenc power tools must only be used with the battery units designed for the purpose. Use of other battery units can present a risk of injury and fire.
- 20. Recharge only with the charger specified by the manufacturer. A charger adapted to one type of battery unit may present a fire risk if used with a different battery unit.
- 21. Do not use the battery for any purpose other than that initially envisaged (exclusively for use with Pellenc tools).
- 22. At the end of its life, the battery must be returned to the authorized distributor from whom it was purchased to be recycled in accordance with waste regulations.
- 23. Fragile case, contains an electronic board and lithium.

2.3. SAFETY MEASURES WHEN USING THE "PELLENC" CHARGER

- 1. When in operation, the charger's temperature can reach 60°C. No flammable material must be within 1.5 metres of the charger and battery.
- 2. Place the charger out of the reach of children and on a non-combustible support.
- 3. Do not interfere with its cooling cycle.
- 4. The charger is intended only for recharging the battery. Do not charge non-rechargeable batteries.
- 5. The charging location must be equipped with a class D fire extinguisher (for metal fires) in good working order.
- 6. If the output cord is cut or damaged, bring the entire charger back to the authorised distributor where the tool was purchased.
- 7. Only recharge using the "PELLENC" charger indicated by the manufacturer. A charger adapted to one type of battery unit may present a fire risk if used with a different battery unit.
- 8. This charger is designed to charge Pellenc tool lithium batteries.
- 9. Do not use it for any other purposes.
- 10. Children must be supervised to ensure they do not play with the charger.
- 11. Check that the cable cannot be bent and that it does not touch hot surfaces or sharp edges.
- 12. Ensure good ventilation during the charging.
- 13. Never cover the charger. This charger must not be used outdoors.
- 14. Make sure the power connector is not exposed to water.
- 15. Never attempt to charge a damaged battery.
- 16. The grid connection must comply with national electrical regulations.
- 17. Check the wiring of the charger before use. Never use the charger if the wiring is damaged.
- 18. When the battery is charging, place the charger on a non-flammable support, more than 1.5 m away from any flammable object.




2.4. SAFETY SIGNAGE

Power Pack M



Power Pack L (depending on configuration)

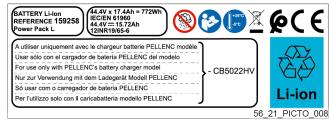





Do not expose to rain.



Read the user guide.



This equipment must be used at a temperature of between -5° and +35°C.



Marking symbol for identifying the chemical characteristic of the battery during recycling.



Lithium-ion battery.

At the end of its life, the battery must be returned to the authorized distributor from whom it was purchased to be recycled in accordance with waste regulations.



Tool compliant with Moroccan standards.



Tool compliant with EC standards.



3. DESCRIPTION AND TECHNICAL CHARACTERISTICS

3.1. TECHNICAL CHARACTERISTICS - BATTERY

Battery	Power Pack M	Power Pack L (depend	ding on configuration)
Rated battery voltage	43.2V	44.4V	43.2V
Type of battery	12 x 3 cells per pack	12 x 6 cells per pack	12 times 5 elements included in 1 pack
Battery capacity	10.35Ah	17.4Ah	16.5Ah
Battery energy	447Wh	773Wh	745Wh
Battery life	Depending on the tool		
Battery weight	2.93 kg	4.89 kg	4.52 kg
Operating frequency band		13.56 Mhz, Receiver	

3.2. TECHNICAL FEATURES - CHARGER CB5022HV


Commercial reference of the charger	57256
Voltage	100-240V ~ 50/60W 130W class II
Charging voltage	50.2 V dc
Charging current	2.2A DC max.

	Battery:		Power Pack L
CB5022HV charger (2.2 A)	70%	3hrs. 20mins	5hrs. 30mins
	100%	5hrs. 30mins	8hrs. 30mins

3.3. DESCRIPTION

Battery


- 1. Gauge display
- 2. Charge connector cap
- 3. Charging connector
- 4. Tool power supply connector
- 5. On/Off button

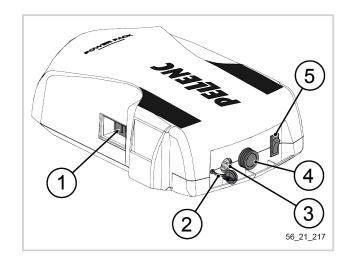

PELLENC POWER TOOL BATTERY POWER PACK M, L 56 159267-A

Charger

- Charging connector
- 7. Indicator light
- 8. Power cord

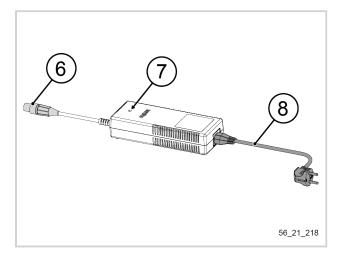

4. COMMISSIONING

4.1. SWITCHING THE BATTERY ON AND OFF

- Set the switch (5) to the off position "0"
- Set the switch (5) to the on position "I".

4.2. BATTERY DISPLAY

The battery has a gauge display showing the remaining capacity it holds. The capacity is expressed as a percentage.

- If the gauge display shows 99, the battery is fully charged.
- If the gauge display indicates a value greater than \$5 after one day of work, it is not necessary to recharge the battery for a second day of work.
- ullet If the gauge display shows 00 or a value close to it, you must recharge immediately.

4.3. CHARGING THE BATTERY

Note


When the battery is discharged, the tool stops automatically; the gauge display (1) indicates 00 and the buzzer beeps intermittently (see Section 6.1, "Summary of charge indicator and beep messages").

1. Check that the battery switch (5) is off (position '0').

Note

Before using the battery for the first time at the start of a new season, it must be fully charged (99% steady).

 Place the charger and battery in a dry, ventilated and dust-free room at 10#25°C. Place the battery in a stable position.

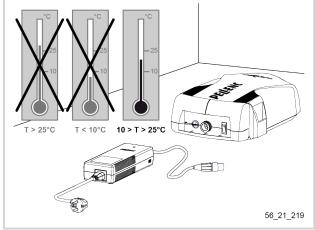

♠

Caution


Before connecting the charger to the mains, check that your power system characteristics comply with the specifications given on the charger (see Section 3.2, "Technical features - Charger CB5022HV").

- 3. Connect the mains plug of the charger (8) to the mains. The charger LED lights up red.
- 4. Connect the charging cord (6) to the charging connector (3) of the battery.

Note

The battery beeps twice when it recognises the charger.


The charger CB5022HV LED turns green and flashes after a few seconds.





Charging is finished when the message 99 appears on the gauge display.

The battery charging LED (7) will flash green to indicate that the battery is being charged.

It flashes while charging, and shows steady when the charging is completed.

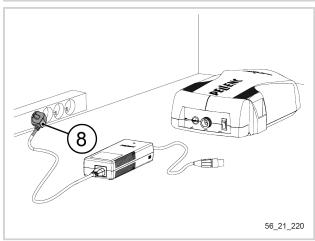

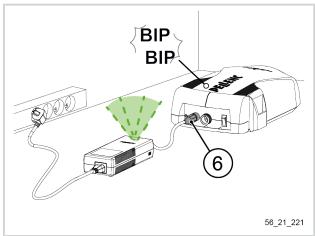

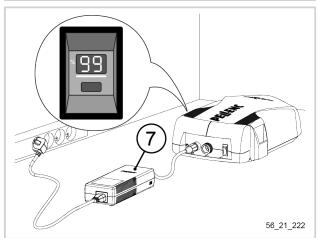


PELLENC POWER TOOL BATTERY POWER PACK M, L 56 159267-A

5. When the battery is charged, first disconnect the charging cord (6) from the battery and then the mains plug from the charger (8).

Note

After a long storage period (new battery, winter storage etc.), when you disconnect the charger, the charge level indicator may display a value of less than 99%. This is a normal phenomenon which can reoccur for up to 5 charge cycles with normal use between each charge.

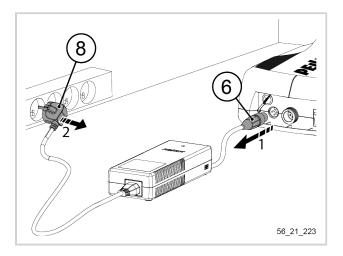


4.4. FITTING THE BATTERY ON THE HARNESS AND CONNECTING THE TOOL



Caution


To protect your back, take the time to adjust your harness properly.




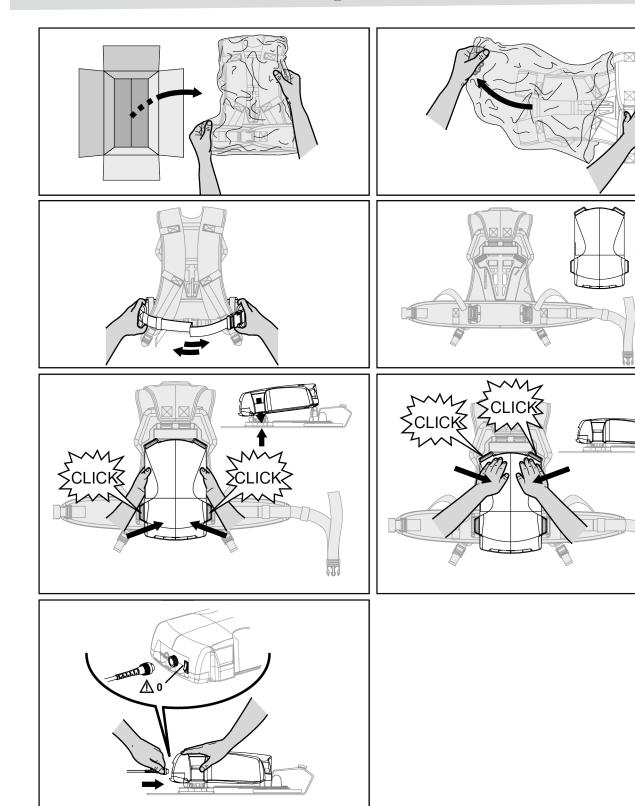



56_21_271




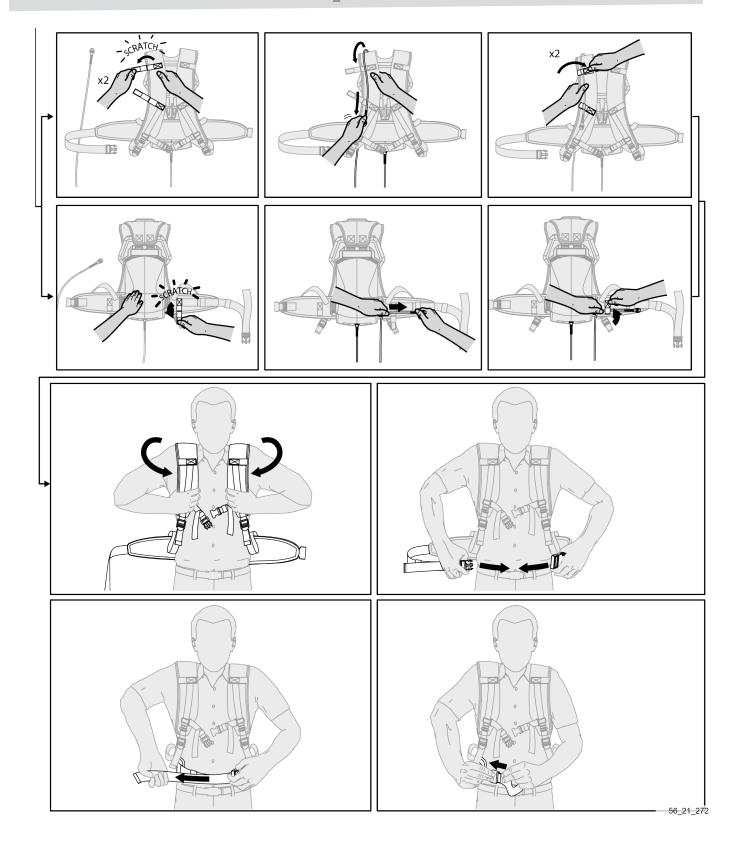


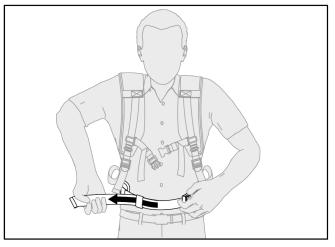


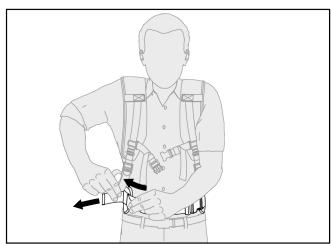

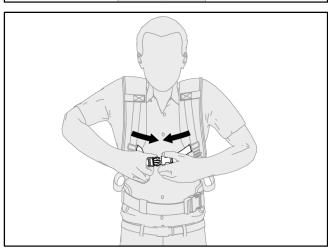

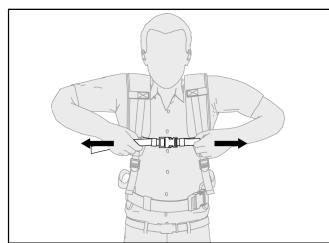

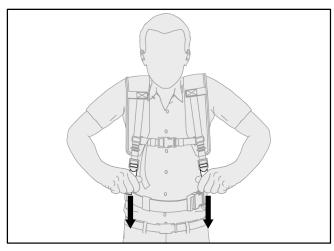

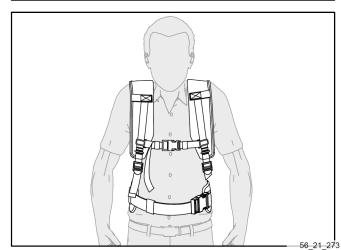

Important

Never force the connectors.

Only use tools whose connector is the same colour as the tool power connector on your battery (3).

If not, ask your authorised dealer to confirm the compatibility of your tools with the battery.



5. MAINTENANCE



Warning

® Never carry out maintenance on damaged battery packs. Service of battery packs should only be performed by the manufacturer or authorized service providers.

The battery must be replaced only by an approved distributor.

5.1. MISCELLANEOUS MAINTENANCE BATTERY



Caution

The battery must not be connected to the charger or the tool.

- 1. Check that the battery switch (5) is off (position '0').
- 2. Disconnect the battery.
- 3. Clean the battery casing with a soft damp cloth.

5.2. MISCELLANEOUS MAINTENANCE CHARGER

- Disconnect the charger.
- 2. Clean the charger housing with a soft damp cloth.

6. INCIDENTS AND TROUBLESHOOTING

6.1. SUMMARY OF CHARGE INDICATOR AND BEEP MESSAGES

Normal messages			
U	se		
BB fixed	Battery charge level (0 to 99)		
with 1 beep per minute	Battery empty, recharge immediately		
Cha	rging		
flashing every 4 seconds	Battery charge level (0 to 99)		
99 fixed Charging complete			
Storage			
Off	Standby		



PELLENC POWER TOOL BATTERY POWER PACK M, L 56_159267-A

Degraded mode messages		
Use		
and 55 alternately	Stop the tool; the battery temperature is too high	
and and alternately	Stop the tool; the battery temperature is too low	
NO.MAGE	Electronic board out of order	
N.N.M.23	Electronic board not configured	
Fixed	Cell voltage too low	
Long beep and 1 short beep	Tool stop: tool intensity too high	
Long beep and 2 short beeps	Incompatible tool detected	
Long beep and 4 short beeps	Stop the tool; the tool temperature is too high	
Charging		
and alternately	Charge interrupted: Battery temperature too low	
Charge interrupted: Battery temperature too hig		

Fault messages		
	Use	
and 1 beep every 2 minutes for 24 hours	Voltage too low after 3 hours of non-use. Recharge battery immediately	
HS _{NOTANIS}	Electronic board out of order	
COUNTS SOURCES	Short circuit on the tool connector	
Long beep and 5 short beeps	Loss of connection, tool not detected	
Charging		
and alternating and continuous beep	Battery problem	
PB and BH alternately	Charger problem	



6.2. TROUBLESHOOTING

The battery does not start be bestievy does not start be bestievy and so so start be bestievy and so so so start beep per minutes Cand Eand End E	Incident / breakdown	Messages on the battery dis- play and/or sound signals	Probable cause	Checks	Solutions	Repairer
Battery temperature Battery temperature too low Battery configuration / At an authorised distery at end of life / Problem with contacts on the electronic board / Battery are and of life / Problem with contacts on the electronic board / Switch / Fuse Battery temperature limit alternately Battery temperature limit atternately Battery temperature limit atternately Battery temperature too low alternately Charger fault Check the compatible charger circuit board At an authorised distributor PELLENC tributor PELLENC tributor per laternate too low alternately Charger fault Check that the charger circuit board At an authorised distributor PELLENC tributor PELLENC tributor per low tributor PELLENC tributor per low tributor per low tributor per low tributor per laternately circuit board At an authorised distributor per laternated tributor per laternated laternated tributor per laternated tributor per laternated late	tery : start	GB with 1 beep per minute	Empty battery	Check that the battery is not completely discharged	Recharge the battery	User
Battery configuration / Electronic board / Bat- HS Problem with contacts on the electronic board / Switch / Fuse			Battery temperature	Battery temperature too low	Let the battery cool down for about 5 minutes	
tery at end of life / Problem with contacts on the electronic board / Switch / Fuse BB (from 0 to 99)		N. J. I.W. CO.	Battery configuration / Electronic board / Bat-	At an authorised distributor PELLENC	Return the battery to the authorised PELLENC distributor	Authorised distributor
HS board / Switch / Fuse board / Switch / Fuse No display Long beep and 4 short beeps its temperature limit alternately Et and 55 Battery temperature alternately Et and 15 Battery temperature Battery temperature too low alternately Et and 15 Battery temperature Battery temperature too low alternately Charger fault Check the compatitue charger Check that the charger		and access	tery at end of life / Problem with con-			PELLENC
Battery temperature limit alternately		5 H	tacts on the electronic board / Switch / Fuse			
Long beep and The tool has reached 4 beeps from the battery 4 short beeps its temperature limit alternately alternately Battery temperature Battery temperature too low alternately alternately Battery temperature beattery temperature too low alternately alternately alternately alternately alternately alternately alternately charger fault Check that the charger er is not defective circuit board At an authorised distributor PELLENC tributor PELLENC		BB (from 0 to 99)				
Long beep and The tool has reached 4 beeps from the battery 4 short beeps its temperature limit alternately Battery temperature Battery temperature too low alternately Charger fault Check that the charger billity of the charger er is not defective er is not defective tributor PELLENC		No display				
Battery temperature Battery temperature too high alternately Battery temperature too low alternately alternately Battery temperature battery temperature too low alternately Charger fault Check that the charger billity of the charger er is not defective circuit board tributor PELLENC that alternated distributor PELLENC	ol stops g use	Long beep and 4 short beeps	The tool has reached its temperature limit	4 beeps from the battery	Let the tool cool down for roughly 5 minutes	User
Battery temperature too low alternately Battery temperature Battery temperature too low alternately Compatible charger Check that the charger Charger fault Circuit board Battery temperature too low attery temperature too low alternately Check the compatible charger Check that the charger Circuit board At an authorised distributor PELLENC		므립 and 55 altemately	Battery temperature	Battery temper- ature too high	Let the battery cool down for about 5 minutes	
Battery temperature Battery temperature too low alternately Battery temperature too low Battery temperature too high alternately Incompatible charger Check the compatible charger Charger fault Charger fault Charger fault Check that the charger er is not defective er is not defective tributor PELLENC		C and Cand CO and CO alternately		Battery temperature too low	Use the battery within the correct temperature range, see Section 2.2, "Safety measures associated with battery use"	
Battery temper- ature too high Incompatible charger Check the compatibility of the charger Charger fault Check that the charger er is not defective Circuit board At an authorised distributor PELLENC	attery is larging	See and Ge alternately	Battery temperature	Battery temperature too low	Use the battery within the correct temperature range	User
charger Check the compatibility of the charger ault Check that the charger is not defective ard At an authorised distributor PELLENC		Se and US alternately		Battery temper- ature too high	Let the battery cool down for about 5 minutes	
Check that the charger is not defective At an authorised distributor PELLENC		ı		Check the compatibility of the charger	SeeSection 3, "Description and technical characteristics"	
At an authorised distributor PELLENC			Charger fault	Check that the charg- er is not defective	Return the charger to an authorised PELLENC dealer	Authorised distributor
			Circuit board	At an authorised distributor PELLENC	Return the battery to an authorised PELLENC dealer	PELLENC



Incident / breakdown	Messages on the battery dis- play and/or sound signals	Probable cause	Checks	Solutions	Repairer
The battery	ı	Long storage time	1	Perform five charge and discharge cycles	User
does not charge to 100%		Charger fault	Check that the charger is not defective	Return the charger to an authorised PELLENC dealer	Authorised distributor
		Circuit board	At an authorised dis-	Return the battery to the au-	PELLENC
		Battery at end of life	tributor PELLENC	thorised PELLENC distributor	
Important © Never try to ranty).	open any of the cells	of the "battery" pack or the	charger (you risk damaging t	Important © Never try to open any of the cells of the "battery" pack or the charger (you risk damaging them and, above all, you will lose the benefit of the warranty).	of the war-



7. STORAGE AND TRANSPORT

7.1. BATTERY STORAGE CONDITIONS

- Store the battery unit and its charging device in a place away from any heat, dust or dampness, and ensure that the switch is on the "0" off position.
- Never store the battery in an ambient temperature of more than +45 °C.
- In order to conserve a long battery life and prevent deterioration, the battery must be charged when stored and recharged every 24 months if it is not used.
- Do not operate the switch while in storage.
- To ensure long battery life, the battery should be stored in a dry and warm place between 0 °C and 25 °C.
- No combustible object must be placed within 1.5 metres of the battery.
- · The charger is maintenance-free.
- If the battery is not used for 10 days, the battery will automatically discharge until it reaches its storage charge rate, then goes to standby. It will heat up during this phase.

8. ACCESSORIES AND CONSUMABLES

8.1. ACCESSORIES INCLUDED

Name	Reference	
CB5022HV charger (2.2 A)	151965	12 100 Marie 1 100
Carrying harness	132200	PS 27,006

9. WARRANTIES

9.1. GENERAL WARRANTIES

9.1.1. STATUTORY WARRANTY

9.1.1.1. LATENT DEFECTS WARRANTY

Apart from the commercial warranty provided for under Article II, Article 1641 of the Civil Code provides that "the seller is bound to a warranty on account of latent defects of the object sold which render it unfit for the use for which it was intended, or which would impair said use to the extent that the buyer would not have acquired it, or would only have given a lesser price for it, had he known of them".

PELLENC POWER TOOL BATTERY POWER PACK M, L 56 159267-A

Article 1648 of the Civil Code "The action resulting from latent defects must be brought by the purchaser within two years after the discovery of the defect."

9.1.1.2. LEGAL WARRANTY OF CONFORMITY

Article L.217-4 of the French Consumer Code "The seller delivers goods in conformity with the contract and is liable for defects of conformity existing upon delivery".

The seller is also liable for any lack of compliance resulting from the packaging, assembly or installation instructions whenever its contractual liability is engaged in this regard or the latter are carried out under its responsibility.

Article L.217-5 of the French Consumer Code "Goods are compliant with the contract":

- 1. Where they are fit for the purpose normally expected of similar goods and, where applicable:
 - If it matches the description given by the seller and possesses the qualities that were presented to the purchaser in the form of a sample or model;
 - If it possesses the qualities that a purchaser can reasonably expect given the public statements made by the seller, the producer or its representative, especially in advertising or labelling;
- 2. Or, if it has the characteristics defined by mutual agreement of the parties or is fit for any particular purpose that the buyer made known to the seller and that the latter accepted.

Article L.217-12 of the Consumer Code "legal action resulting from lack of conformity lapses two years after delivery of the goods".

9.1.2. COMMERCIAL WARRANTYPELLENC

9.1.2.1. CONTENT

9.1.2.1.1. GENERAL INFORMATION

In addition to legal warranties, client users benefit from the commercial warranty on products PELLENCcovering the exchange and replacement of parts recognised as being out of order, due to machining defects, assembly defects or material defects, whatever the cause.

The warranty is fully integral to the product sold by PELLENC.

9.1.2.1.2. SPARE PARTS

The commercial warranty also covers original PELLENCspare parts, excluding labour and to the exclusion of certain parts of each product provided at delivery.

9.1.2.2. DURATION OF THE WARRANTY

9.1.2.2.1. GENERAL INFORMATION

PELLENC Products are guaranteed under the commercial warranty as from delivery to the customer for a period of two (2) years for products connected to a PELLENC battery, and for a period of one (1) year for other PELLENC products.

9.1.2.2.2. SPARE PARTS

PELLENC Replacement parts replaced under the product warranty are guaranteed under the commercial warranty as from delivery of the PELLENCproduct to the customer user for a period of two (2) years for products connected to a PELLENCbattery, and for a period of one (1) year for other PELLENCproducts.



PELLENC POWER TOOL BATTERY POWER PACK M, L 56 159267-A

In the case of products connected to a PELLENC battery, parts that are replaced under the product warranty after the 12th month of use, are covered for a period of one (1) year.

9.1.2.2.3. WARRANTY EXCLUSIONS

Excluded from the commercial warranty are products that have been subject to abnormal use, or were used under conditions and for purposes other than those for which they were manufactured, especially in the case of non-compliance with conditions stipulated in this operating instructions manual.

It does not apply in case of shock, fall, neglect, lack of supervision or maintenance or in case of transformation of the product. Also excluded from the warranty are products that have been subject to tampering, alteration or modification by the customer user.

Wear parts and/or consumables cannot be covered by the warranty.

9.1.2.3. IMPLEMENTATION OF THE COMMERCIAL WARRANTY

9.1.2.3.1. PRODUCT COMMISSIONING AND COMMISSIONING DECLARATION

No later than eight days after the delivery of the goods to the customer user, the DISTRIBUTOR shall complete the computerized declaration of commissioning form in order to activate the latter on the website www.pellenc.com, under the heading "extranet", menu "Pellenc Extranet Service", using the identifier previously issued by PELLENC.

Failing that, commissioning declaration will not be effective and implementation of the commercial warranty PEL-LENC will not occur. As a consequence thereof, the DISTRIBUTOR must ensure the financial burden of its intervention under the warranty without being able to pass on the cost to the client user.

The DISTRIBUTOR shall also undertake to complete the warranty card or the certificate of warranty and commissioning for self-propelled equipment provided with the product after having the client user sign and date it.

9.1.3. PAID AFTER-SALES SERVICE

9.1.3.1. GENERAL INFORMATION

Malfunctions, breakdowns, breakages resulting from misuse, neglect or improper maintenance by the client user as well as malfunctions resulting from normal wear of the product are subject to the payment of after-sales service, even during the period of the legal and commercial warranty. After-sales service repairs that fall outside of the legal and commercial warranty also include maintenance, adjustments, diagnostics of all types, and cleaning without the present list being exhaustive.

9.1.3.2. WEAR PARTS AND CONSUMABLES

Wear parts and consumables also fall within the after-sales service.

9.1.3.3. SPARE PARTS

Paid after-sales service also covers original PELLENC spare parts, excluding labour and outside the legal and commercial warranty period.

In case of replacement of original PELLENC spare parts in the context of after-sales service, said latter are covered by a warranty of one year as from the installation date.



10. COMPLIANCE STATEMENTS

10.1. "EU" DECLARATION OF CONFORMITY: POWER PACK M & L

MANUFACTURER / ENTITY AUTHORIZED TO COMPILE	PELLENC
THE TECHNICAL FILE	
ADDRESS	Quartier Notre-Dame - 84120 Pertuis (France)

We hereby declare that the product designated below as:

GENERIC DENOMINATION	BATTERY			
FUNCTION	DESIGNED TO POWER PELLENC BATTERY POWER TOOLS			
COMMERCIAL NAME	POWER PACK			
TYPE	Lithium-ion BATTERY			
MODEL	M		L	
SERIAL No.	56W00001 - 56W49999	56X00001 - 56X49999	56Y00001 - 56Y49999	

Complies with all the relevant provisions of EMC Directive 2014/30/EU.

Complies with the provisions of the following European Directives:

 2014/53/EU RED Directive; 2011/65/EU ROHS Directive; 1907/2006 REACH Regulation; 2006/66/EC Batteries & Accumulators Directive

The following harmonised European standards have been used in part or in full:

• EN 62133-2:2017

SIGNED IN PERTUIS, DATED 05/01/2021 JEAN-MARC GIALIS

CHIEF EXECUTIVE OFFICER



PELLENC

Quartier Notre Dame - 84120 Pertuis (France)

